

Window & Door Replacement**FIELD REPORT #**1**Date:** 30-Sep-20

Dunes Of Panama
7205 Thomas Dr
Panama City Beach, FL 32408

WEATHER Clear
TEMP RANGE 52-75
FORECAST Sunny

WORK IN PROGRESS

Construction Mobilization
Mock Up Door Removal
Mock Up Window Removal

SITE PERSONNEL

SunCost Restoration & Waterproofing
Pendleton + Bowman, Inc.



Dunes of Panama maintenance team removed window dressings, & moved furniture away from work area. Ram board was placed on the floors to create a walking path to the sliding doors & windows. Plastic covering was draped over unit furnishings to help protect them from construction dust. Foam board placed in the elevator on the walls & floor for protection.

PENDLETON + BOWMAN, INC.


Interior & exterior sealants around the door frame are removed. Glass panels are then removed and carefully placed to the side.



Door frames were then removed one side at a time to expose rough opening. Exterior tile was cut back to accommodate for new thresholds. Opening was then thoroughly vacuumed & wiped clean of any debris.



PermaBase cut to size, coated, then place on drying rack to cure. A bead of BASF NP 150 sealant is placed on both sides of rough opening, a 'Z' pattern throughout the middle, & 6" up the sides to aid in waterproofing.

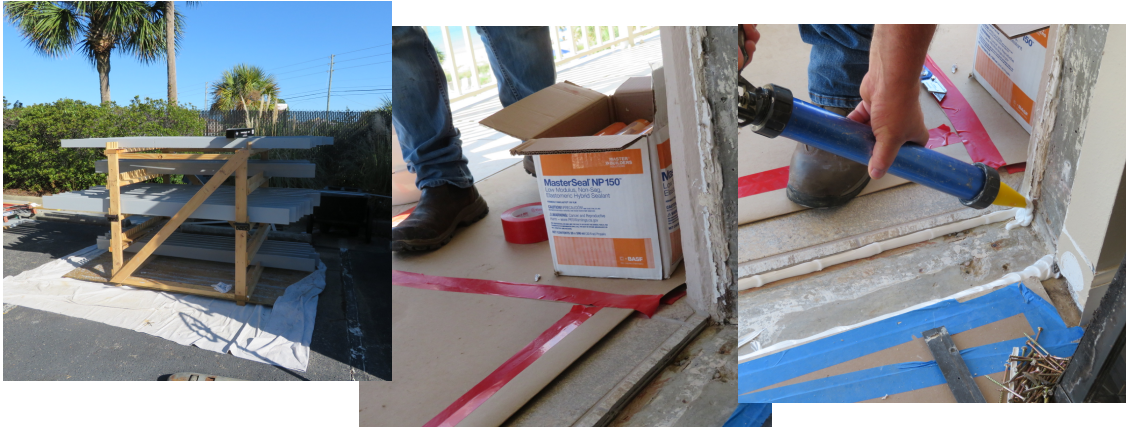

Perma base is then placed into the opening & additional sealant is placed on top of the perma base as well as the anchor head to ensure a water tight seal.

